

Judgeford RD1
Porirus 5381
New Zealand
T +64 4 237 1170
F +64 4 237 1171
branz@branz.co.nz
www.branz.co.nz







BRANZ Type Test FH 5551-TT [2014]

CONE CALORIMETER TEST AND NZBC VERIFICATION METHOD C/VM2 APPENDIX A PERFORMANCE OF KAPO BOARD

CLIENT

Enviro Square Ltd 80 Prince Regent Drive Half Moon Bay Auckland 2012 New Zealand



All tests and procedures reported herein, unless indicated, have been performed in accordance with the laboratory's scope of accreditation.

PROJECT NUMBER:

ISSUE DATE:

EXPIRY DATE:

PAGE:

FT5551

10 July 2014

10 July 2019

1 of 10

TEST SUMMARY

Objective

To conduct cone calorimeter testing and reduce the data in accordance with ISO 5660 on client supplied specimens for the purposes of determination of the Group Classifications in accordance with;

New Zealand Building Code (NZBC) Verification Method C/VM2 Appendix A

Test sponsor

Enviro Square Ltd 80 Prince Regent Drive Half Moon Bay Auckland 2012 New Zealand

Description of test specimen

The product as described by the client as Kapo Board, a calcium silicate panel.

Date of test

11 June 2014.

Test results

For the purposes of compliance with the relevant building code documents, the following classification is considered applicable to the tested sample as described in Section 1.

Building Code Document	Group Number Classification
NZBC Verification Method C/VM2 Appendix A	1-S

LIMITATION

The results reported here relate only to the item/s tested.

TERMS AND CONDITIONS

This report is issued in accordance with the Terms and Conditions as detailed and agreed in the BRANZ Services Agreement for this work.



FH 5551-TT

10 July 2014

2 of 10

10 July 2019



CONTENTS

SIG	NATORI	ES4
DOC	UMENT	REVISION STATUS4
1.	GENI	ERAL5
	1.1	Sample measurements5
2.	EXPE	RIMENTAL PROCEDURE6
	2.1	Test standard6
	2.2	Test date6
	2.3	Specimen conditioning6
	2.4	Specimen wrapping and preparation6
	2.5	Test programme6
	2.6	Specimen Selection6
3.	TEST	RESULTS AND REDUCED DATA7
	3.1	Test results and reduced data – NZBC C/VM27
4.	SUM	MARY8
5.		SIFICATION IN ACCORDANCE WITH NZBC VERIFICATION HOD C/VM2 APPENDIX A9
6.	NZBO	C CONCLUSION9
FIC	SURE	S
	_	
_		esentative specimen (front face on left, back on right)
TA	BLES	
Table	1: Physic	cal parameters5
	•	esults and reduced data – NZBC C/VM27
Table	3: Heat ı	elease rate8
	•	t summary8
Table	5 NZBC	Group classification and smoke extinction area





EXPIRY DATE

PAGE:





SIGNATORIES

Matthew Van Atta

Fire Engineer

Reviewer

P. N. Whiting

Senior Fire Engineer/Fire Testing Team Leader IANZ Approved Signatory

DOCUMENT REVISION STATUS

ISSUE NO.	DATE ISSUED	EXPIRY DATE	DESCRIPTION
1	10 July 2014	10 July 2019	Initial Issue

1. GENERAL

The product submitted by the client for testing was identified by the client as Kapo Board, a calcium silicate panel. Figure 1 illustrates a representative specimen of that tested.

Figure 1: Representative specimen (front face on left, back on right)



1.1 Sample measurements

The following physical parameters were measured for each specimen prior to testing.

Table 1: Physical parameters

	Initial p	Initial properties		
Specimen ID	Specimen ID Mass (g) Mean thickne (mm)		density (kg/m³)	
FH5551-1-50-1	103.3	9.1	1135	
FH5551-1-50-2	105.3	9.1	1157	
FH5551-1-50-3	106.2	9.1	1167	





ISSUE DATE:

EXPIRY DATE

PAGE:

MNV



2. EXPERIMENTAL PROCEDURE

2.1 Test standard

The tests were carried out and data reduced according to the test procedures described in ISO 5660: (2002), Reaction-to-fire tests – Heat release, smoke production and mass loss – Part 1: Heat release rate, and Part 2: Smoke production rate. The sample preparation and test procedure are as described in 2.4 and 2.5.

2.2 Test date

The tests were conducted on the 11 June 2014 by Mr Lukas Hersche at BRANZ Limited laboratories, Judgeford, New Zealand.

2.3 Specimen conditioning

All specimens were conditioned to moisture equilibrium (constant weight), at a temperature of $23 \pm 2^{\circ}$ C and a relative humidity of $50 \pm 5\%$ immediately prior to testing.

2.4 Specimen wrapping and preparation

All tests were conducted and the specimens prepared in accordance with the test standard. The spark igniter and the stainless steel retainer frame were used. All specimens were wrapped in a single layer of aluminium foil, covering the unexposed surfaces.

2.5 Test programme

The test program consisted of three replicate specimens as identified in the above table, tested at an irradiance level of 50 kW/m². All tests were carried out with the specimen horizontal, and with a nominal duct flow rate of 0.024 m³/s.

2.6 **Specimen Selection**

BRANZ was not involved in the selection of the materials submitted for testing. The test materials used were supplied to the laboratory by the client.





FH 5551-TT

10 July 2019



3. TEST RESULTS AND REDUCED DATA

3.1 Test results and reduced data – NZBC C/VM2

Table 2: Test results and reduced data - NZBC C/VM2

Material		Test specimens as described in Section 1 (in accordance with ISO 5660)			Mean
Specimen test number		FH5551-1-50-1	FH5551-1-50-2	FH5551-1-50-3	
Test Date		11/06/2014	11/06/2014	11/06/2014	
Time to sustained flaming	S	No Ignition	No Ignition	No Ignition	
Observations ^a		-	-	-	
Test duration ^b	S	1800**	1208*	1800**	1603
Mass remaining, m _f	g	89.0	92.5	89.6	90.4
Mass pyrolyzed	%	13.9%	12.1%	15.6%	13.9%
Specimen mass loss ^c	kg/m²	1.6	1.4	1.9	1.6
Specimen mass loss rate ^c	g/m² .s	0.9	0.8	1.0	0.9
Heat release rate					
$_{ m peak,}\dot{q}_{ m max}^{\prime\prime}$	kW/m²	10.6	13.1	8.5	10.7
average, $\dot{q}_{avg}^{\prime\prime}$					
Over 60 s from ignition	kW/m²	0.1	0.4	0.3	0.3
Over 180 s from ignition	kW/m²	1.8	2.0	1.9	1.9
Over 300 s from ignition	kW/m²	3.2	2.7	2.9	2.9
Total heat released	MJ/m ²	4.3	2.6	4.4	3.8
Average Specific Extinction Area	m²/kg	7.4	NR	NR	7.4
Effective heat of	MJ/kg	2.7	1.8	2.3	2.3

Notes:

NR not recorded



REPORT NUMBER: FH 5551-TT

ISSUE DATE:

10 July 2014

EXPIRY DATE

10 July 2019

PAGE: **7 of 10**

MNV



a no significant observations were recorded

^b determined by * X₀₂ returning to the pretest value within 100 ppm of oxygen concentration for 10 minutes

^{** 30} minutes after time to sustained flaming

^c from ignition to end of test;

d from the start of the test

⁺ value calculated using data beyond the official end of test time according to the test standard.

4. SUMMARY

The test standards requires that the mean heat release rate (HRR) readings over the first 180 s from ignition for the three specimens should differ by no more than 10% of the arithmetic mean of the three readings. In the event of this criterion not being met, a further three specimens are required to be tested.

Table 3: Heat release rate

Specimen ID	Average HRR over 180 s from ignition	Arithmetic mean	% difference from the arithmetic mean
FH5551-1-50-1	1.8		-4.2%
FH5551-1-50-2	2.0	1.9	4.6%
FH5551-1-50-3	1.9		-0.4%


Table 33 identifies that the specimens exposed to 50 kW/m² irradiance meet the acceptance criteria.

The report summary for the specimens as described in Section 1, exposed to an irradiance of 50 kW/m² is given in table below with rates of heat release illustrated in Figure 2.

Table 4: Report summary

Mean Specimen thickness (mm)	Irradiance (kW/m²)	Mean Time to Ignition (s)	Mean Peak Heat Release Rate (kW/m²)	Average Specific Extinction Area (m²/kg)
9.1	50	No Ignition	10.7	7.4

Figure 2: Rate of heat release versus time

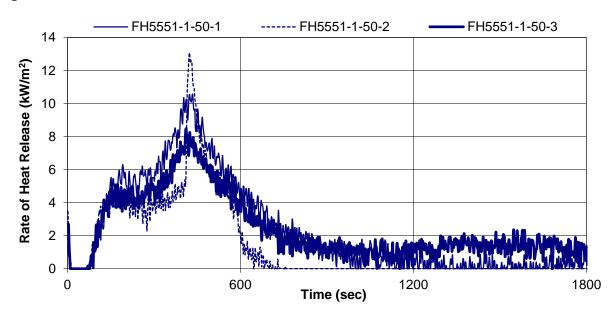



REPORT NUMBER: FH 5551-TT

ISSUE DATE: **10 July 2014**

EXPIRY DATE

10 July 2019

PAGE: **8 of 10**

MNV



5. CLASSIFICATION IN ACCORDANCE WITH NZBC **VERIFICATION METHOD C/VM2 APPENDIX A**

The following classification has been assessed in accordance with the New Zealand Building Code Verification Method C/VM2 Appendix A: Establishing Group Numbers for lining materials. Calculations were carried out according to section A1.3 for predicting a material's group number for each specimen tested. It states that "If a different classification group is obtained for different specimens tested, then the highest (worst) classification for any specimen must be taken as the final classification for that material." The classification for the specimens as described in Section 1 is as follows:

Table 5: NZBC Group classification and smoke extinction area

	Sample 1	Sample 2	Sample 3	Classification
Group number Classification	1	1	1	1-S
Average Specific Extinction Area (m²/kg)	7.4	NR	NR	1-3

The tested samples recorded an average specific extinction area less than 250 m²/kg. In accordance with Verification Method C/VM2 Appendix A, samples achieving either a Group number classification 1 or 2, and with an average specific extinction area less than 250 m²/kg are identified with "S" post-script to the Group number.

6. NZBC CONCLUSION

The cone calorimeter testing was carried out on the specimens as described in Section 1. For the purposes of compliance with the NZBC Verification Method C/VM2 Appendix A, the following classification is considered applicable to the material as described in Section 1.

Group Number Classification	1-8
-----------------------------	-----





FH 5551-TT

10 July 2014

10 July 2019

9 of 10





BRANZ Type Test Summary

This is to certify that the specimen described below has been tested by BRANZ Ltd on behalf of

Enviro Square Ltd 80 Prince Regent Drive Half Moon Bay Auckland 2012 New Zealand

Test standard: ISO 5660 Parts 1 and 2.

Specimen name: Kapo Board.

Specimen description: Calcium silicate panel.

Orientation: From the direction tested.

A full description of the test specimen and the test results are given in BRANZ Test Report:

Fire Test FH 5551-TT - Test date 11 June 2014

Regulatory authorities are advised to examine test reports before approving any product.

The test results were the basis for the following:

Building Code Document	Group Number Classification
NZBC Verification Method C/VM2	1-S
Appendix A	1-3

Issue Date: Expiry Date:

18 June 2014 18 June 2019



All tests and procedures reported herein, unless indicated, have been performed in accordance with the laboratory's scope of accreditation.



FH 5551-TT

ISSUE DATE:

10 July 2014

EXPIRY DATE

PAGE:



